

Service Bulletin

Mazda Motor of America, Inc.
7755 Irvine Center Drive
Irvine, California 92718
Telephone (714) 727-1990

MAZDA

Category S	Applicable Model/s 1995 Millenia	Subject RATTLING NOISE FROM FUEL TANK	Bulletin No. 011/95
			Issued 4/5/95
			Revised

APPLICABLE MODELS/MINS

1995 Millenia vehicles with a VIN of JM1TA22**S1112112 and lower.

DESCRIPTION

A rattling noise may be heard around the fuel tank area while traveling on rough roads. The noise is caused by interference between the fuel tank heat shield and the fuel tank.

To prevent this noise, the shape of the pad installed on the heat shield has been changed and another pad has been added.

If a customer complains of noise around the fuel tank, follow the procedures in this bulletin to eliminate the noise.


REPAIR PROCEDURE

1. Verify the complaint. If the noise is being produced from an area other than the fuel tank, refer to the workshop manual for troubleshooting and repair procedures.
If the noise is coming from the fuel tank area, proceed to step 2.
2. Lift the vehicle on a hoist.
3. Bend the heat shield away from the fuel tank approximately 5mm. Refer to Fig. 1
4. Test drive the vehicle to verify the repair.

WARRANTY INFORMATION

(Applies To Verified Customer Complaints On Vehicles Covered Under Normal Warranty. Refer To The SRT Microfiche For Warranty Term Information).

Warranty Type: A
Symptom Code: 82
Damage Code: 97
Part Number Main Cause: T001 42 740B
Quantity: 0
Operation Number: XX0658RX
Labor Hours: 0.2Hrs.

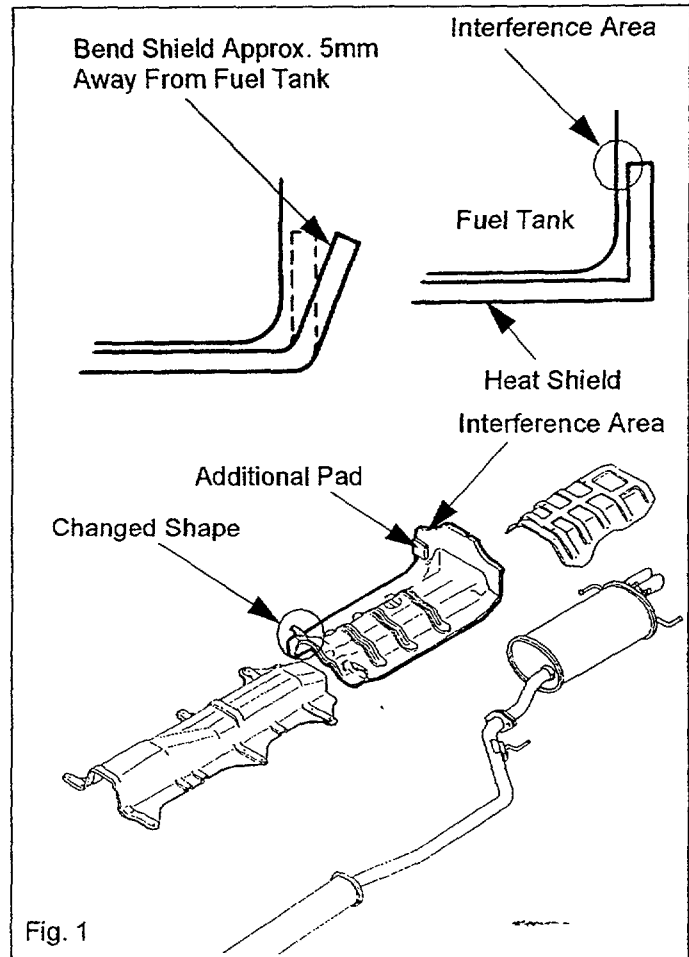

IMPORTANT: Service and Parts Managers should read this bulletin carefully, sign and convey all information to those concerned.

Signature _____

Service Manager

Signature _____ Index # 042730

Parts Manager**