

# Service Bulletin

Mazda Motor of America, Inc.  
7755 Irvine Center Drive  
Irvine, California 92718  
Telephone (714) 727-1990



Category <b>S</b>	Applicable Model/s <b>1995 Millenia</b>	Subject <b>REAR SEAT BACK RATTLE</b>	Bulletin No. <b>022/95</b>
			Issued <b>7/19/95</b>
			Revised

### APPLICABLE MODELS/VINS

1995 Millenia vehicles with a VIN of JM1TA22\*\*S1120462 and lower


### DESCRIPTION

A rattle noise may be heard around the rear seat back when traveling on rough roads. This noise is caused by the seat back bushing. To prevent this noise, the bushing has been modified as shown below.

Customers complaining of this noise should have the bushing replaced with a new part.

### REPAIR PROCEDURE

1. Verify that the noise is coming from the seat back by applying pressure to the bushing area while the noise is occurring.
  - If the noise is coming from an area other than the seat back, refer to the workshop manual for troubleshooting and repair instructions.
2. Replace the seat back bushings (3 areas).
3. Confirm repair.

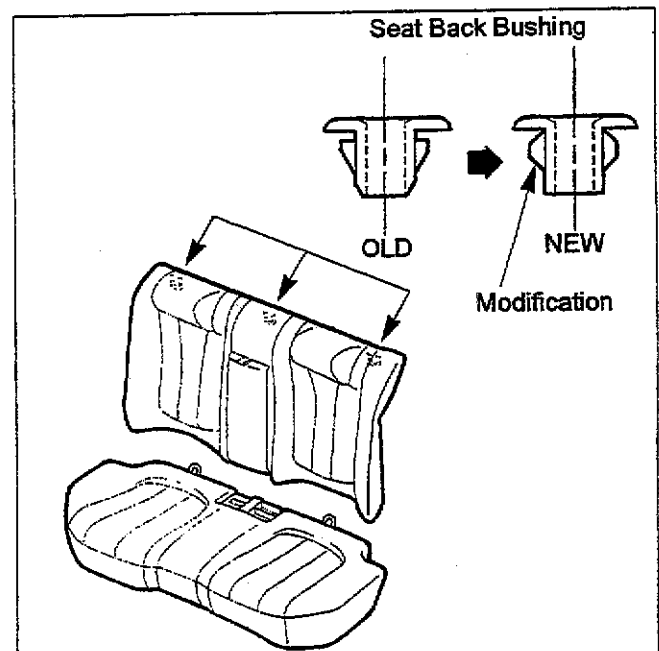

### PARTS INFORMATION

Part Number		Description	Qty	Int.
New	Old			
G213 57 522A	G213 57 522	Bushing, RR Seat Back	3	A

**Interchangeability "A"** means the new part can be used in place of the old part, but the old part cannot be used in place of the new part.

**WARRANTY INFORMATION** (Applies To Confirmed Customer Complaints On Vehicles Covered Under Normal Vehicle Warranty. Refer To The SRT Microfiche For Warranty Term Information)

Warranty Type: **A**  
Symptom Code: **82**  
Damage Code: **97**  
Part Number Main Cause: **G213 57 522A**  
Operation Number: **XX0724RX**  
Labor Hours: **0.4Hrs**

**IMPORTANT:** Service and Parts Managers should read this bulletin carefully, sign and convey all information to those concerned.

**059734**

Signature \_\_\_\_\_

Signature \_\_\_\_\_