

# Service Bulletin

Mazda Motor of America, Inc.  
7755 Irvine Center Drive  
Irvine, California 92718  
Telephone (714) 727-1990



Category S	Applicable Model/s 1995 Millenia	Subject CUP HOLDER OPERATION	Bulletin No. 039/94
			Issued 12/23/94
			Revised

### APPLICABLE MODELS/MINS

1995 Millenia vehicles with a VIN of JM1TA22\*\*S118593 and lower

### DESCRIPTION


The cup holder may not open completely or may move roughly during operation. The configuration of the spring has been changed to improve the cup holder performance.

If a customer complains about the cup holder operation, remove the original cup holder and replace it with the modified holder.

### REPAIR PROCEDURE

**NOTE:** Do not force the cup holder open with a screw driver or other device. Damage to the woodgrained center panel will result.

1. Verify complaint.
2. Remove the center panel (p/n T002 55 210).
3. Remove the cup holder from the center panel and replace with a modified holder.
4. Install center panel assembly.
5. Verify repair.

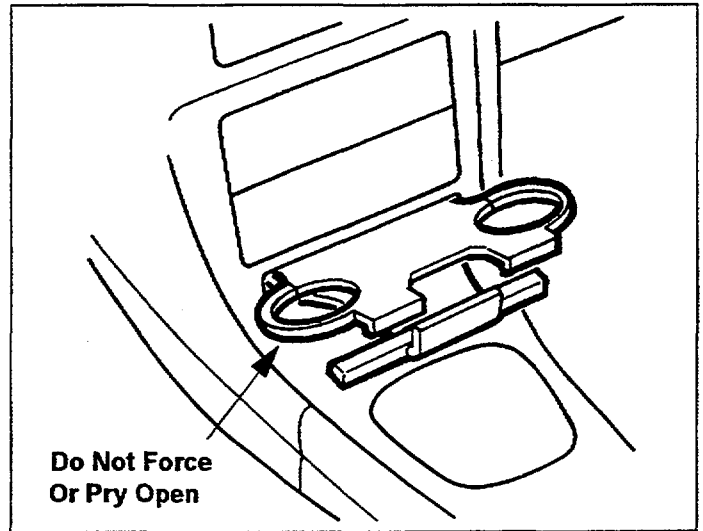

### PARTS INFORMATION

Part Number		Description	Quantity	Int.
New	Old			
TA01 64 39XE	TA01 64 39XD	Cup Holder	1	A

**Interchangeability Note:** A = The new part can be used in place of the old part but the old part can not be used in place of the new part.

### WARRANTY INFORMATION

*(Applies To Verified Customer Complaints On Vehicles Covered Under Normal Warranty. Refer To The SRT Microfiche For Warranty Term Application.)*

Warranty Type: A  
Symptom Code: 92  
Damage Code: 9A  
Part Number Main Cause: TA01 64 39XE  
Quantity: 1  
Operation Number: S0702XRX  
Labor Hours: 0.3 Hrs.

**NOTE:** Center trim replacement is not warrantable if broken during this repair.

**IMPORTANT:** Service and Parts Managers should read this bulletin carefully, sign and convey all information to those concerned.

Signature \_\_\_\_\_ Signature \_\_\_\_\_

Page 1 of 1 Service Manager Index # **040968** Parts Manager