

Service Bulletin

Mazda Motor of America, Inc.
7755 Irvine Center Drive
Irvine, California 92718
Telephone (714) 727-1990

MAZDA

Category S	Applicable Model/s 1995 Millenia	Subject CENTER SUNVISOR HOLDER CRACKED	Bulletin No. 015/96
			Issued 04/18/96
			Revised 05/15/96

NOTE: The PNMC for this concern has been updated. Please replace the original bulletin with this revised copy.

APPLICABLE MODELS

1995 Millenia with a VIN of JM1TA22**S1145148 and lower.

DESCRIPTION

When positioning the sunvisor, the center sunvisor holder may crack.


Ultra-violet rays deteriorates the grease applied to the holder. This deterioration results in a solvent crack across the center sunvisor holder.

The grease applied to the holder has changed.

Customers complaining of this concern, should have the holder replaced.

REPAIR PROCEDURE

1. Verify concern.
2. Replace the holder.

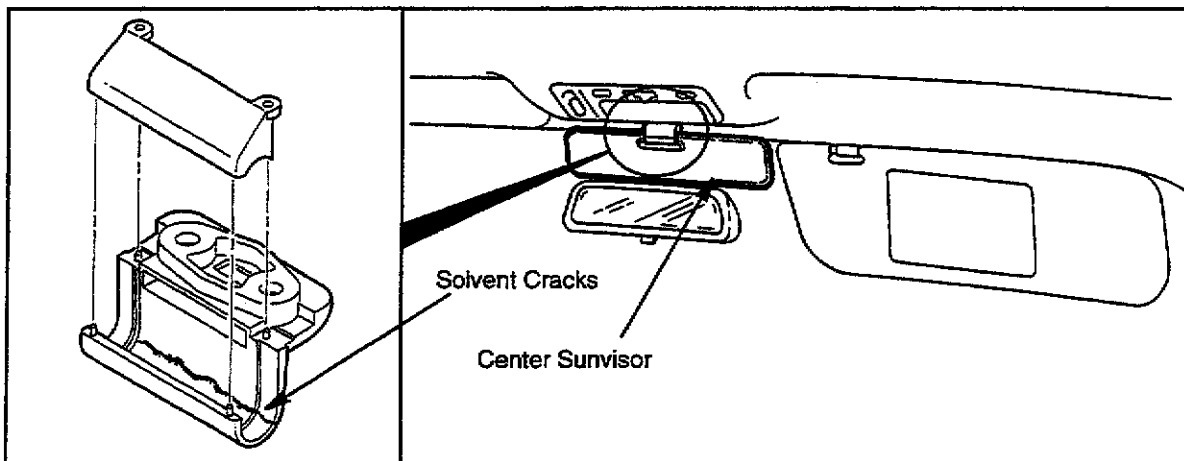

PARTS INFORMATION - There has been no change to the part number.

WARRANTY INFORMATION

(Applies To Verified Customer Complaints On Vehicles Covered Under Normal Warranty. Refer To The SRT Microfiche For Warranty Term Information.)

Warranty Type: A
Symptom Code: 92
Damage Code: 9E
Part Number Main Cause: T001-69-290A (XX) Include color code suffix for warranty claim submission.
Quantity: 1
Operation Number: S1806XRX
Labor Hrs.: 0.2Hrs

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools / equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership.